

Pre-shipment Inspection Report

Report #:PSI20200413-200331-H

General Information:	
Client name	XXX
Product name	SUNGLASSES
Item	XXX
PO#	XXX
Ordered quantity(Lot size)	12096pcs
Inspection Date	Apr.13,2020
Arrival time	08:30
Departure time	17:00
Supplier name	XXX
Factory name	XXX
Inspection location	XXX



Inspection Summary					
Inspection Sections	Conform?	Remarks			
1. Product quantity check	Pending	Remark 1.1			
2. Workmanship appearance/ Function inspection	Within AQL		Cr	Ma	Mi
		Found	0	0	16
		Max Allowed	0	14	21
		Sample Size	315	315	315
		Most serious defects found: /			
3. Test checking/Special check points	Pending	Remark 3.1,3.2,3.3			
4. Packing/Packaging	Pass				
5. Shipping marks/Label/Marking	Pending	Remark 5.1			
6. Product conformity/Measurement	Pending	Remark 6.1			

Conclusion	PENDING (Client has the final decision to Reject or Approve)
-------------------	--

AQI Remarks	
1	Quantity Check
1.1.	Upon the arrival, 92% products were finished and 78% packed into cartons.
2	Workmanship
2.1.	Selected 315pcs samples for inspection, found 0pcs major defects and 16pcs minor defects, for the defects found during inspection, the inspector had already shown to the factory and requested them to replace or repair these defects.
3	Testing and special check points

3.1.	Factory refused inspector to do Carton drop test.
3.2.	For 91207 Smoke/Blue Mirror Polarized light test, found result was 9-10 degree beyond +/-3 degree.
3.3.	Customer no provided product size for checking. Please see actual found.
4.	Packing Check
4.1.	12pcs per PDQ, 6 PDQ per carton.
5.	Shipping marks inspection/Marking/Label
5.1	No provided shipping mark info for inspection reference. Please see actual found.
5.2	Found the Model #, PO number and UPC are conforming to client's documents.
6.	Product conformity inspection
6.1	The approval sample was not available for reference on site.

Pictures of remarks

Remark #3.2: For 91207 Smoke/Blue Mirror Polarized light test, found result was 9-10 degree beyond +/-3 degree.





Manufacturer Signature	Frida	AQI Inspector	Jack Yang Bruce Huang	AQI Report Approver	Richard Song
---------------------------	-------	---------------	--------------------------	------------------------	--------------

Inspection Method Applied:

Inspection type	Pre-Shipment Inspection					
Inspection Standard	ANSI/ASQ Z1.4 (ISO2859-1)					
Sampling plan	Single, normal					
Inspection level	G – II					
AQL:	Cri.	0	Maj.:	2.5	Min.:	4.0
Sample size inspected	315pcs					
Total number of AVAILABLE cartons:	131ctns					
Quantity for selected cartons	14ctns					
Carton # of the selected cartons	164/101/55/140/92/9/64/128/59/6/99/60/46/147					

1. Product Quantity Inspection:

Item No.	Color	Ordered Qty.(Pcs)	Available Qty.(Pcs)	Packed Cartons	Unpacked Cartons	Not finished QTY	Sample Size	
							Pieces	Cartons
BBO-SG-PDQ	14318 Crystal Blue w/ Black Rubber Smoke/Blue Mirror	1008	1008	131	0	0	26	14
	14318 Tortoise w/ Black Rubber Copper/Green Mirror	1008	1008		0	0	26	
	14318 Crystal Silver Outside/Gloss Black Inside Smoke/Blue Mirror	1008	1008		0	0	26	
	91066 Gloss Black w/ Black Rubber Smoke/Blue Mirror	1008	1008		0	0	26	
	91066 Tortoise w/ Black Rubber Copper/Green Mirror	1008	1008		0	0	26	
	91066 Gloss White w/ Black Rubber Copper/Green Mirror	1008	1008		0	0	26	
	91201 Matte Black Smoke/Blue Mirror	1008	1008		0	0	26	
	91201 Gloss White Smoke/Blue Mirror	1008	1008		0	0	26	
	91201 Tortoise Copper/Green Mirror	1008	1008		0	0	26	
	91207 Matte Black Smoke/Blue Mirror	1008	1008		0	0	27	
	91207 Tortoise Copper/Green Mirror	1008	1008		0	0	27	
	91207 Crystal Grey Smoke/Blue Mirror	1008	1008		0	0	27	
Total		12096	12096	131	0	0	315	14

2. Workmanship Appearance / Function inspection

General requirement from client:

#	Description	Cri.	Maj.	Min.	Remarks
14318	Glue mark on frame			1	Reworked
	Foreign mater on frame			1	Replaced
	Dirty mark on lens			2	Reworked

	Scratch mark on lens			1	Replaced
	Particle on frame			1	Reworked
	Bubble on frame			1	Replaced
91066	Scratch mark on frame			1	Replaced
	Bubble on frame			1	Replaced
	Dirty mark on frame			1	Reworked
91201	Color stain on frame			1	Replaced
	Scratch mark on frame			1	Replaced
	Dirty mark on lens			1	Reworked
	Particle on frame			1	Reworked
91207	Glue mark on frame			1	Reworked
	Scratch mark on frame			1	Replaced
Total Defects		0	0	16	Within AQL
Maximum allowed Defects		0	14	21	
Sample size		315	315	315	

Pictures of defects

Item: 14318



Glue mark on frame-minor



Foreign mater on frame-minor



Dirty mark on lens-minor



Dirty mark on lens-minor

	
Scratch mark on lens-minor	Particle on frame-minor
	N/A
Bubble on frame-minor	N/A
Item:91066	
	
Scratch mark on frame-minor	Bubble on frame-minor



	N/A
Dirty mark on frame-minor	N/A
Item: 91201	
	
Color stain on frame-minor	Scratch mark on frame-minor
	
Dirty mark on lens-minor	Particle on frame-minor
Item:91207	

	
Glue mark on frame-minor	Scratch mark on frame-minor

3. Reliability Tests/Special Check Points


#	Testing Description	Sample Size	Result	Remark
3.1.	Barcode scanning test	S-2	Pass	
	Barcode should be read easily and correctly			
3.2.	3M tape testing on coating	S-2	Pass	
	Logo not peel off or fade after testing.			
3.3.	Carton drop testing	1carton/item	Pending	Factory refused to do Carton drop test
	According to ISTA-1A			
3.4.	Polarized light test	1 pc/item	Pending	For 91207 Smoke/Blue Mirror Polarized light test, found result was 9-10 degree beyond +/-3 degree.
	/			
3.5.	Water floating test	S-2	N/A	

Pictures of Tests

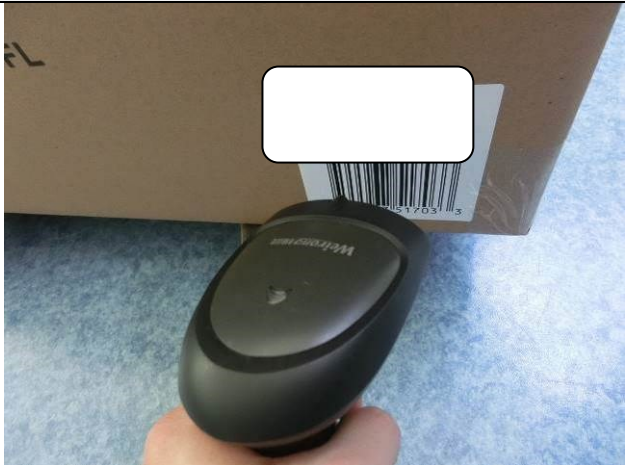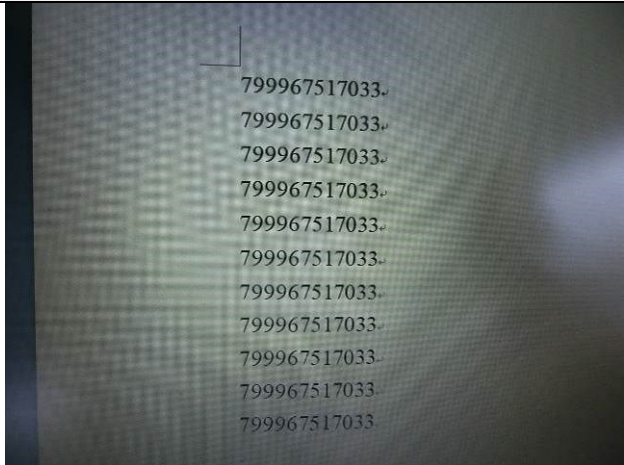	
Barcode scanning test	Barcode scanning test




Barcode scanning test

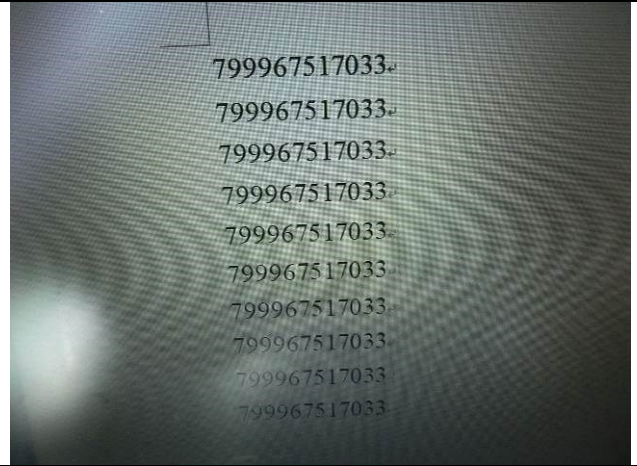


Barcode scanning test



Barcode scanning test

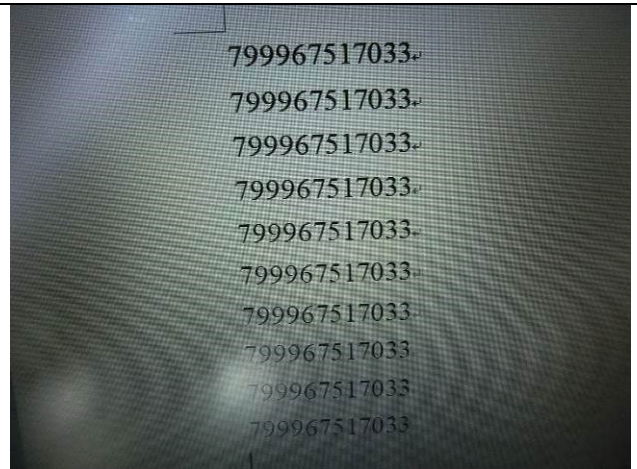

Barcode scanning test

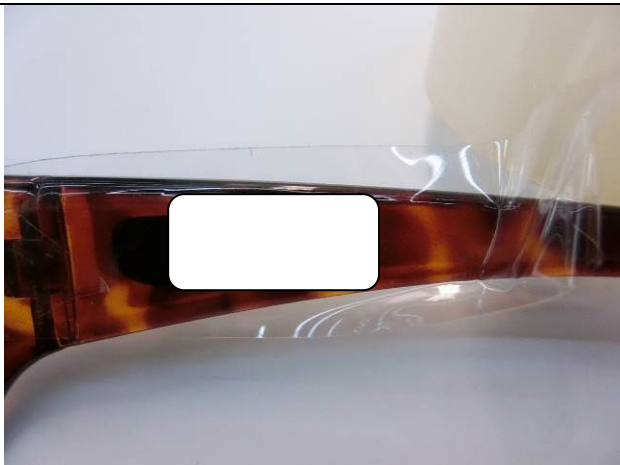

3M tape testing on coating



3M tape testing on coating



3M tape testing on coating




3M tape testing on coating




3M tape testing on coating




3M tape testing on coating

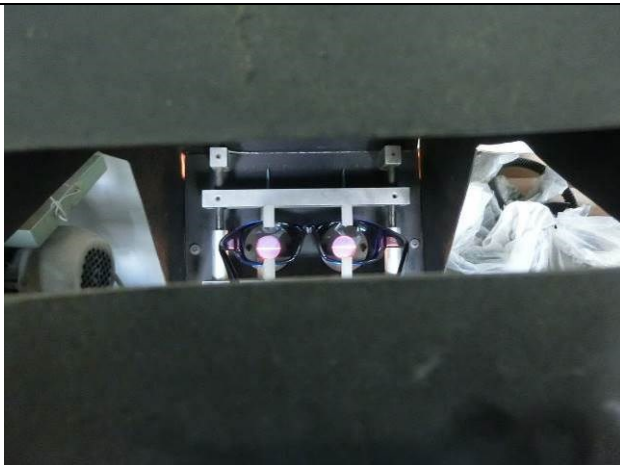

Polarized light test

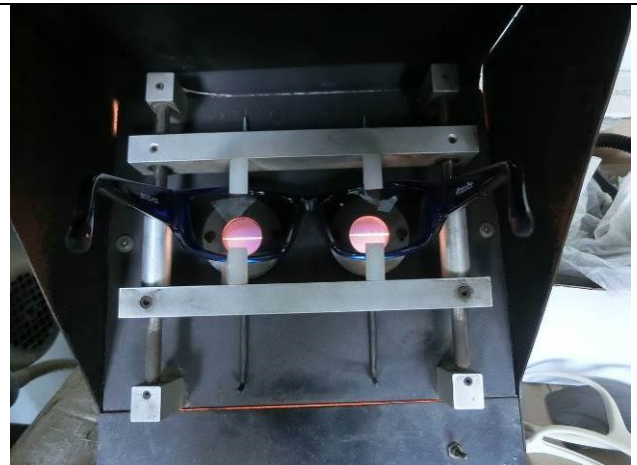

Polarized light test

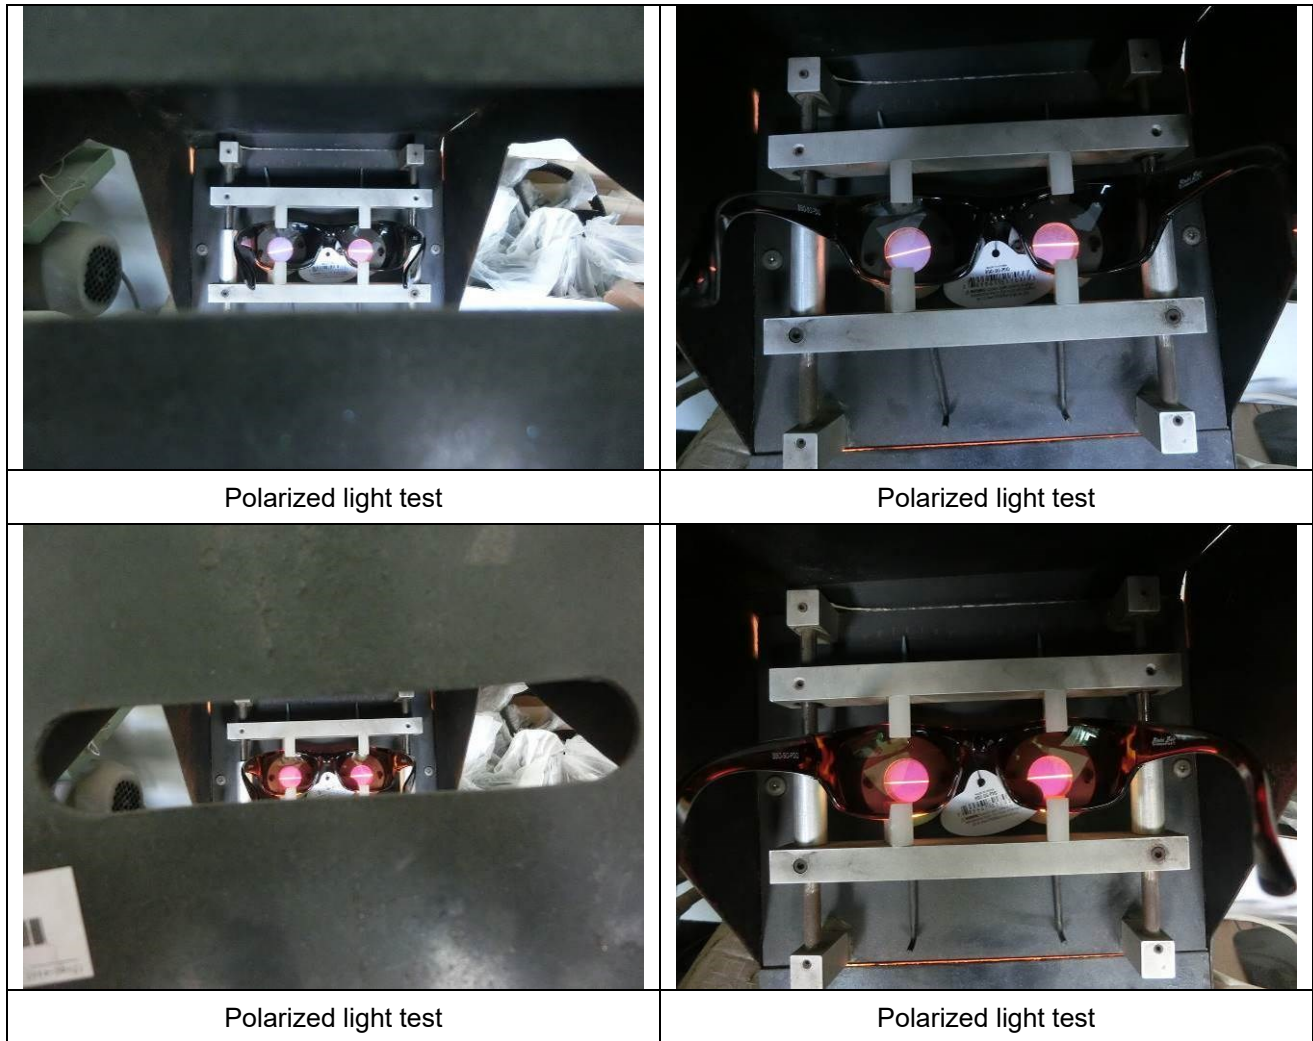

4. Packing/Packaging Inspection

General requirement from client:

#	Check Points	Result	Remarks		
4.1.	Packing Method	Pass	Please see actual findings in report		
4.2.	Packing Quantity	Pass	Please see actual findings in report		
4.3.	Metal staples on carton	N/A			
4.4.	Polybag with warning clause/Polybag with Air holes	N/A	Sealing	Warning text	Punch holes
			☐ Yes	☐ Yes	☐ Yes
			☒ No	☒ No	☒ None
4.5.	Desiccant	N/A			
4.6.	Tissue paper	N/A			
4.7.	Carton filling has no over-packed, no gap, no crash are allowed	Pass			
4.8.	No found mixed sizes cartons	Pass			
4.9.	If the packaging check conform to client's documents	Pass			
4.10.	Carton size/weight	Pass			

Item#	Qty (Pcs)		Carton size(cm)		Carton weight(Kg)	
	Inner box	Outer carton	Marking	Actual	Marking	Actual
BBO-SG-PDQ	12	72	69x35x32	68x36x32	6.8	6.65

5. Shipping Marks /Label/Marking Inspection

General requirement from client:

#	Check points	Result	Remarks
5.1	Shipping mark	Pass	
5.2	Barcode Verification	Pass	Barcode on Shipping package: 799967517033 Barcode on Retail packaging / Product: 799967517033
5.3	Care/composition label	Pass	
5.4	Country origin label	Pass	Made in China
5.5	Poly bag printing / label	N/A	
5.6	Inner box printing / label	Pass	
5.7	Other label or marking	N/A	

6. Product Conformity / Measurement Inspection:


General requirement from client:


#	Check Points	Result	Remarks
6.1	Product Overview	Pass	
	Requirement:		
6.2	Sample Comparison	Pending	The approval sample was not available for reference on site.
	Requirement:		
6.3	Product size/Weight	Pending	Actual found
	Requirement:		
6.4	Other size or measurement	N/A	
	Requirement:		

Item#	Product size on spec	Actual Product size(cm)	Product weight on spec	Actual Product weight(g)
14318	/	14.0x16.5x4.4	/	30.2
91066	/	14.3x16.3x4.4	/	28.2
91201	/	14x16.7x4.5	/	26.1
91207	/	14.3x16.5x4.8	/	28.8


Pictures for packing, shipping marks and product checking



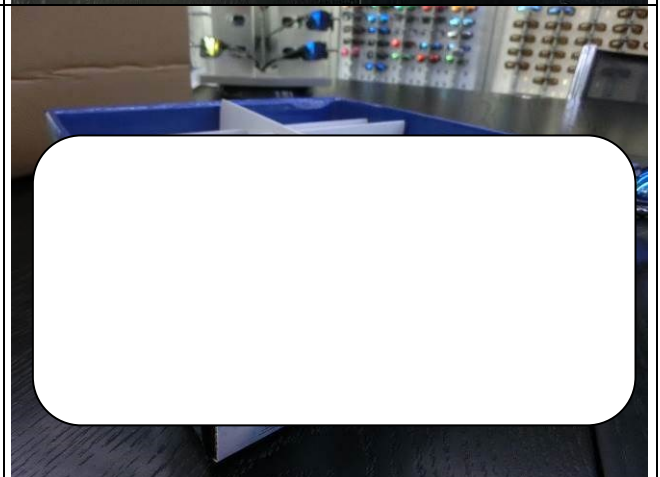

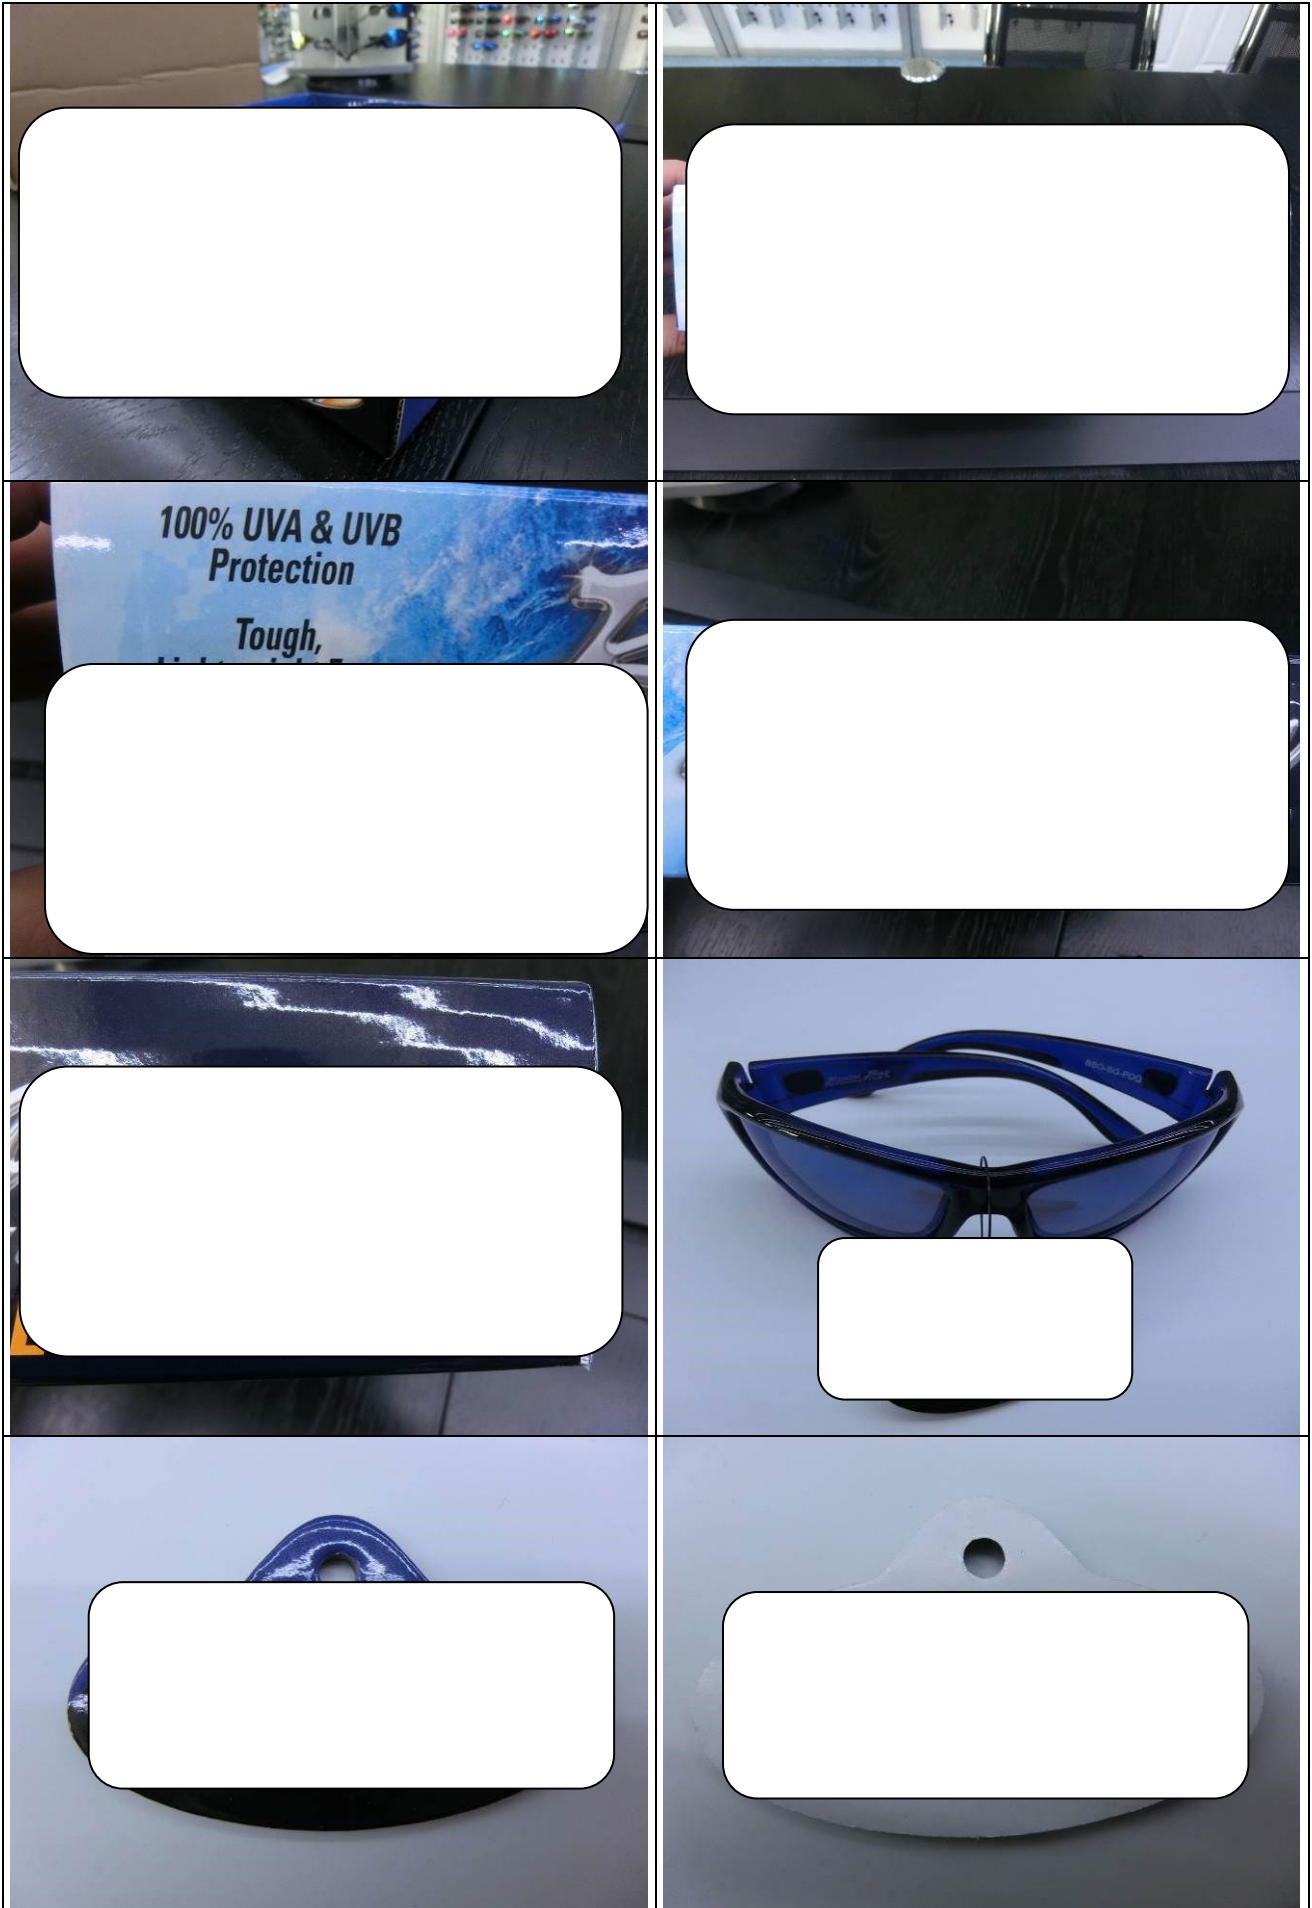




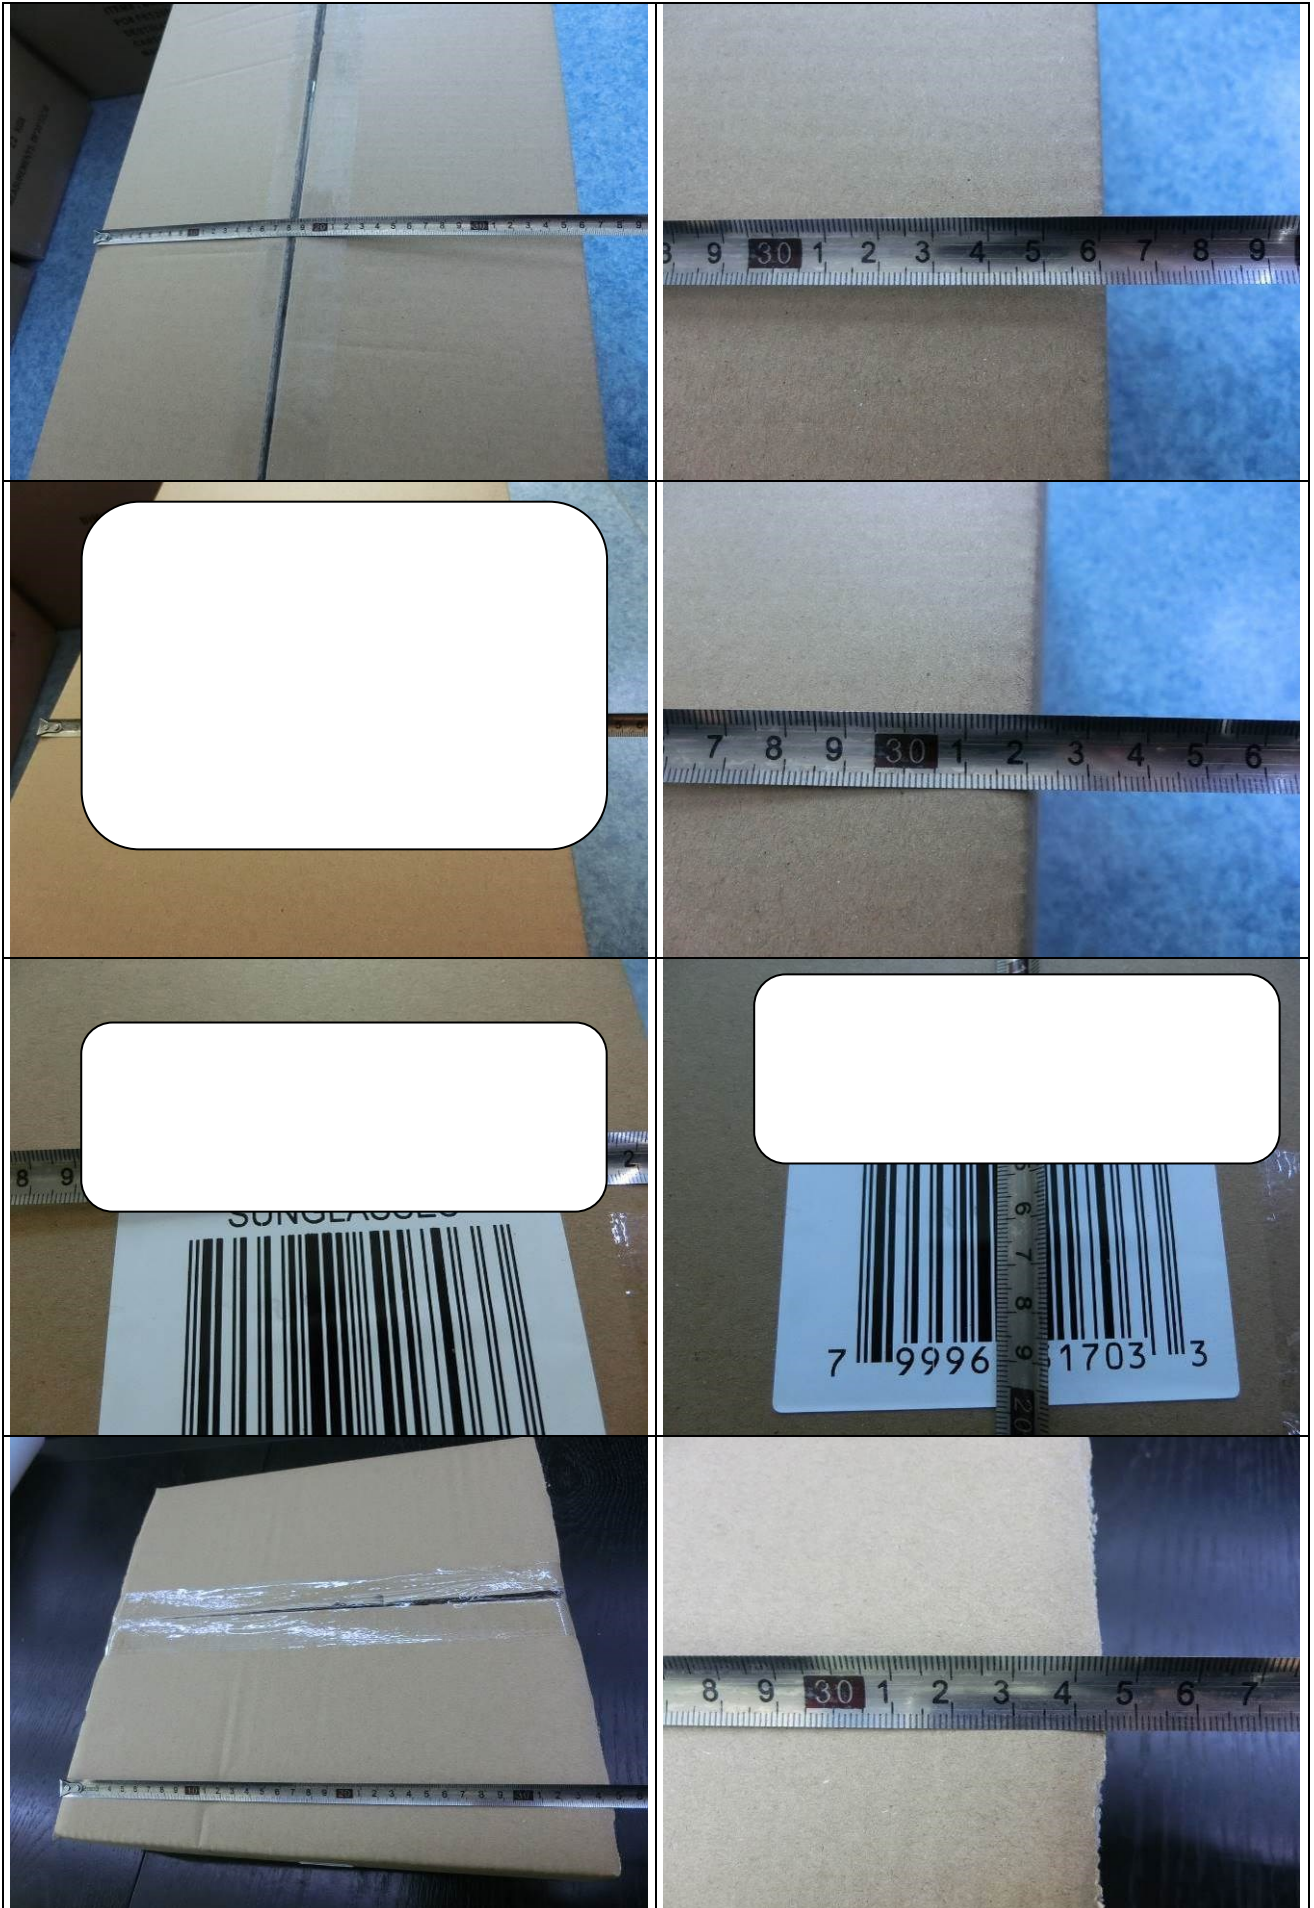









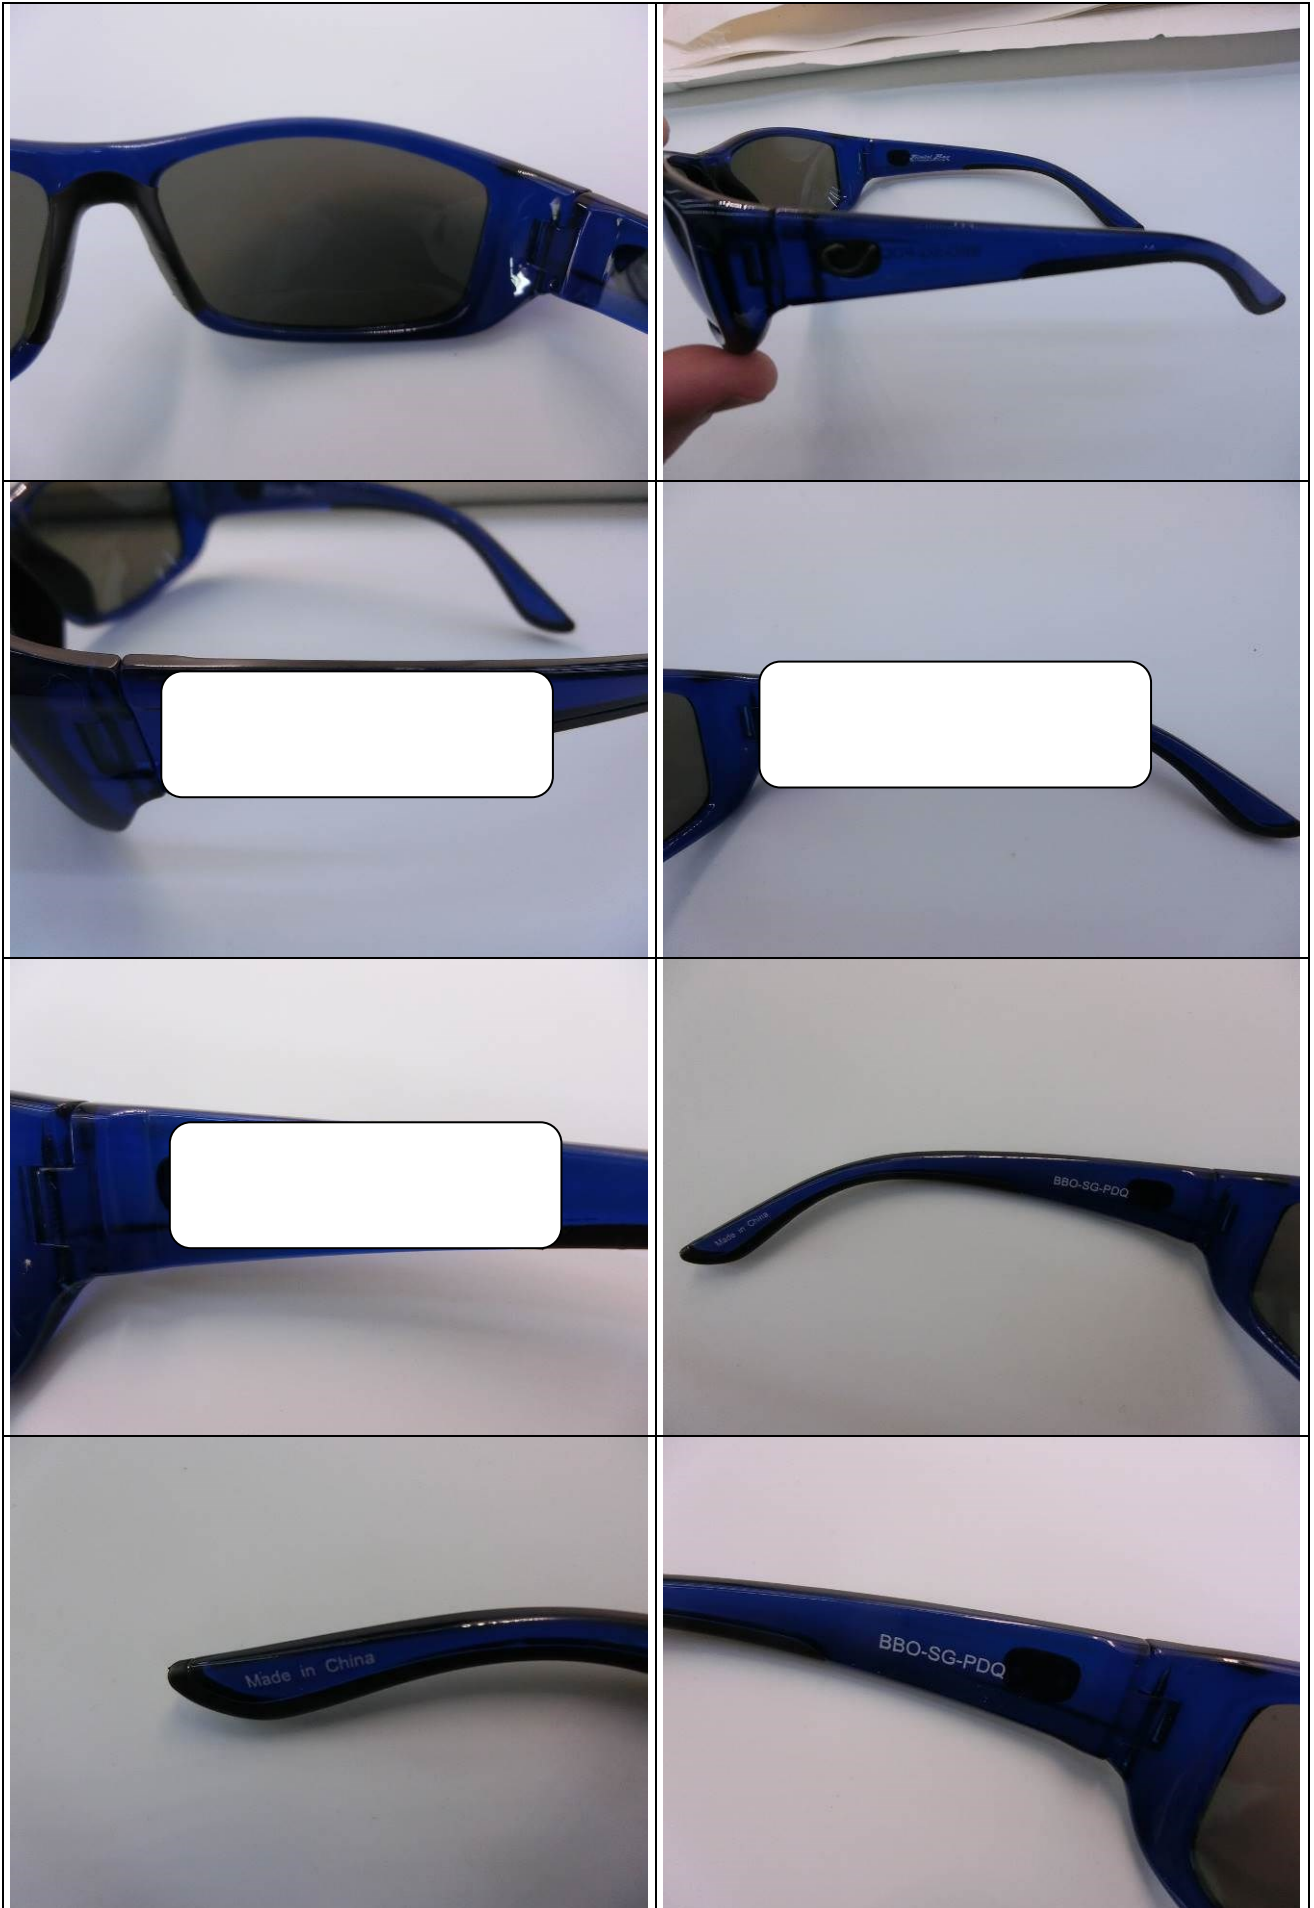



14318 Tortoise w/ Black Rubber
Copper/Green Mirror

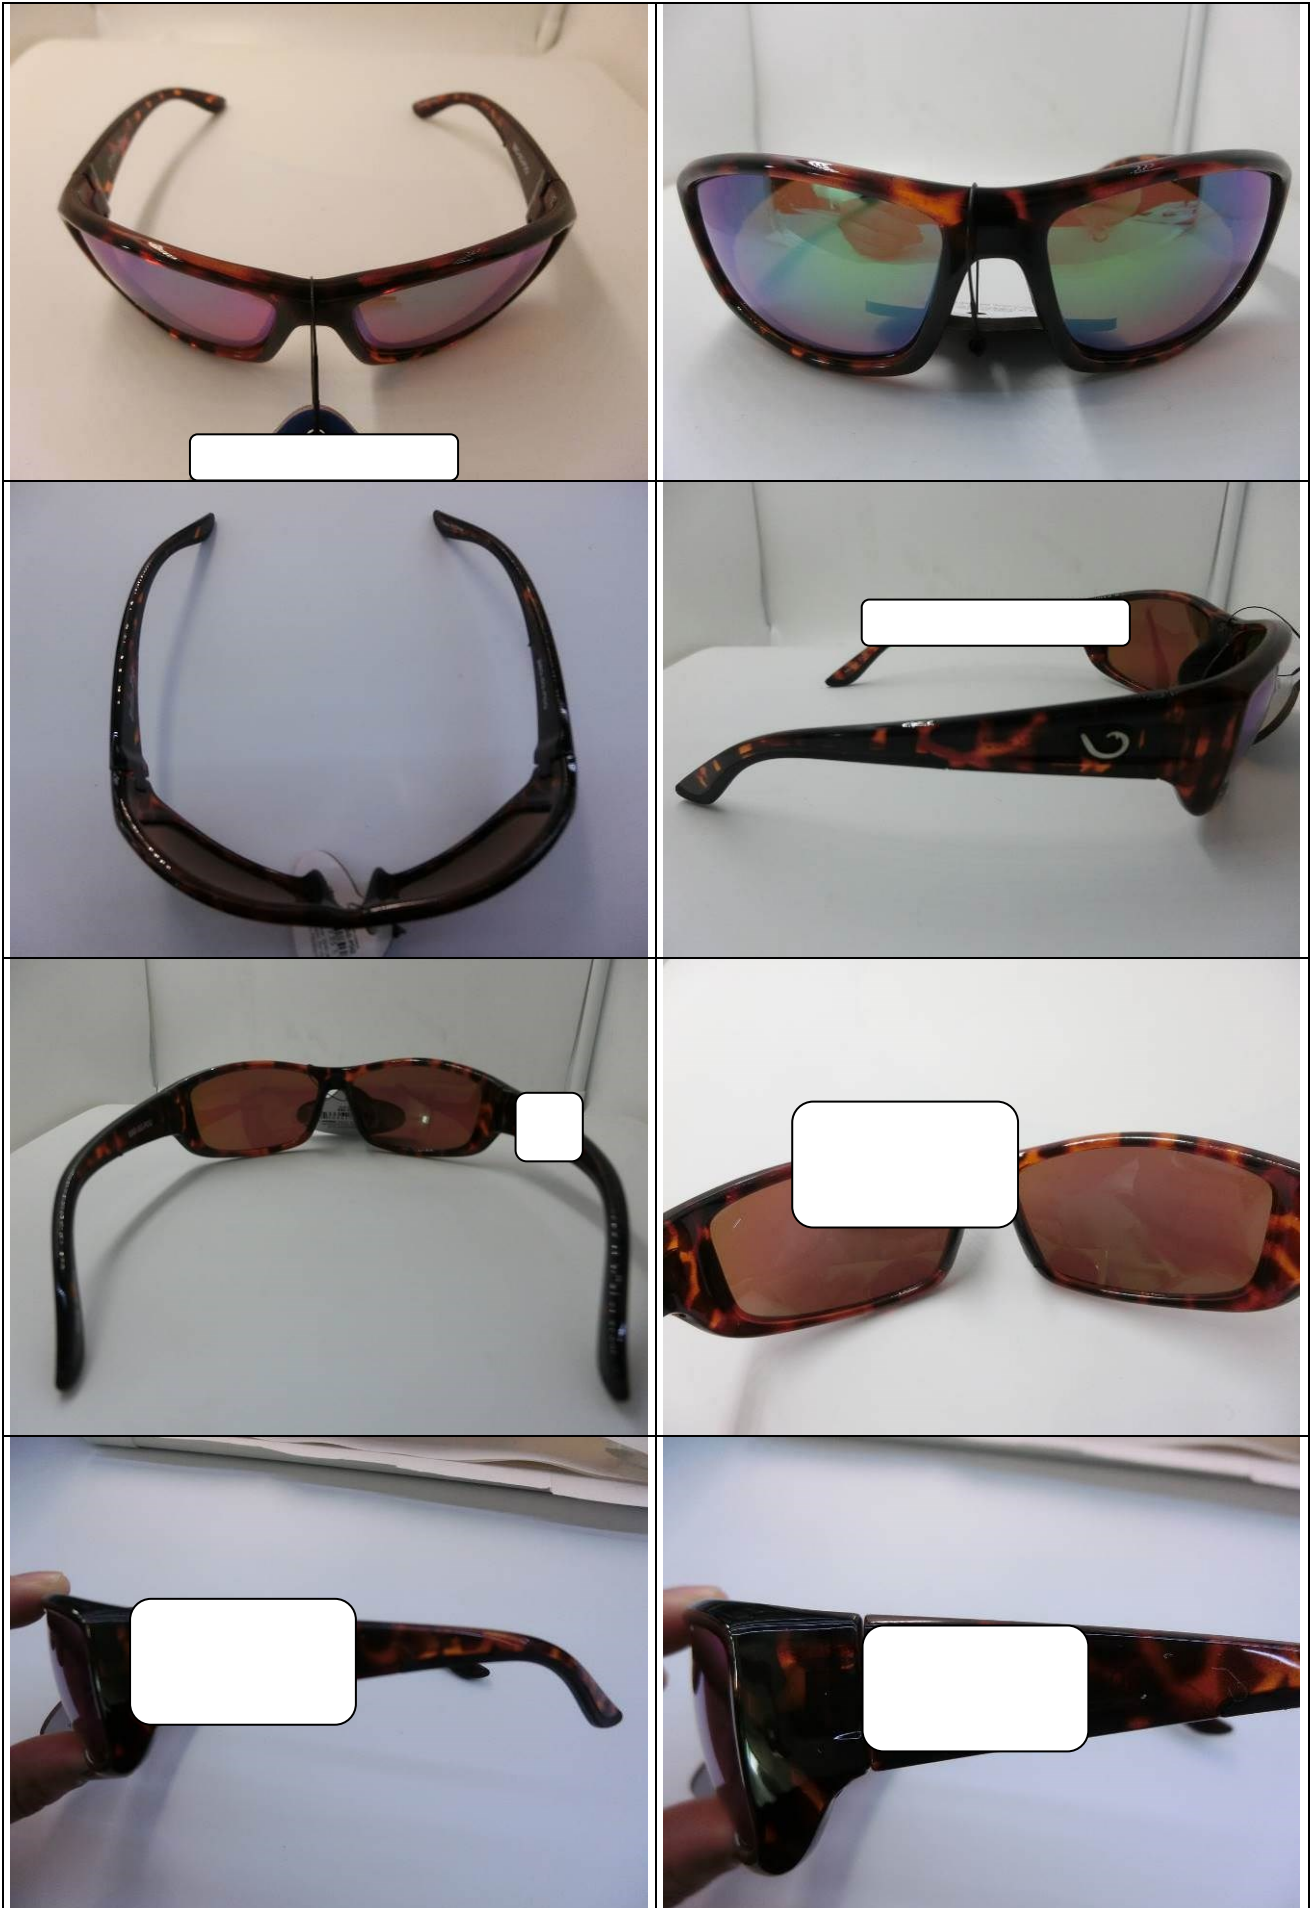

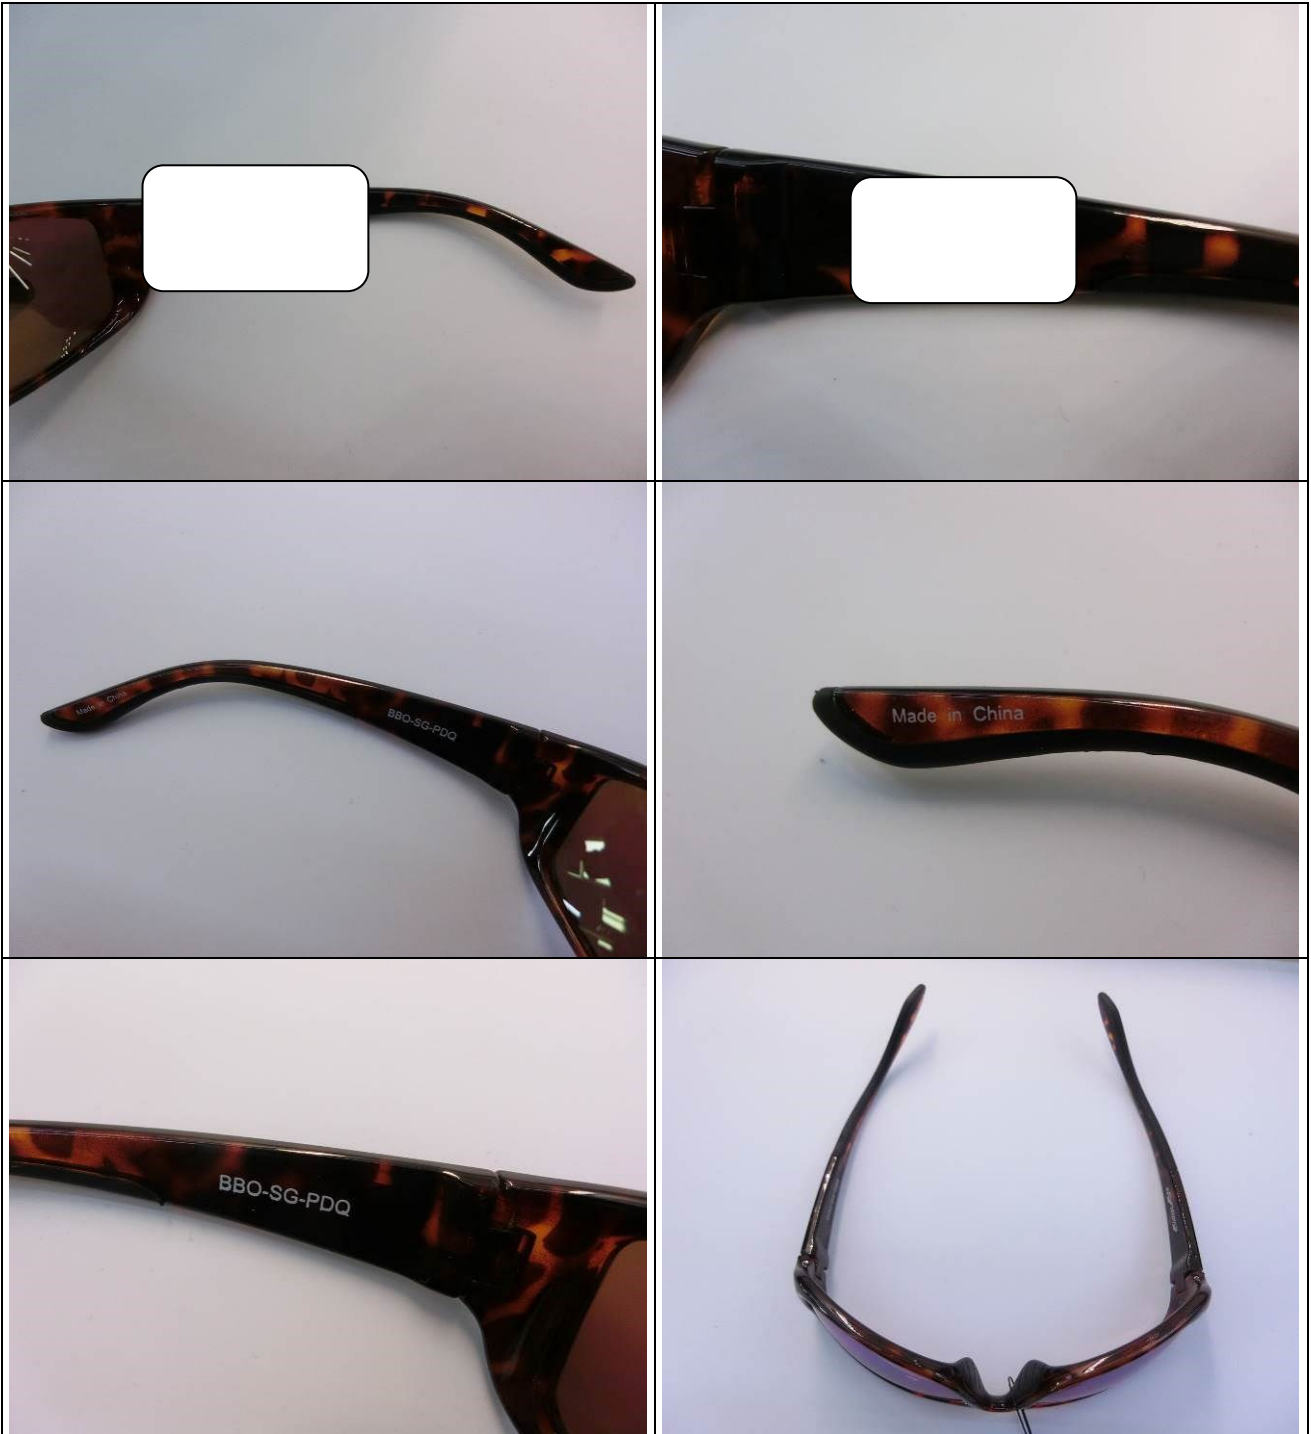

14318 Crystal Silver Outside/Gloss Black Inside
Smoke/Blue Mirror





91066 Gloss Black w/ Black Rubber
Smoke/Blue Mirror







91066 Tortoise w/ Black Rubber
Copper/Green Mirror





91066 Gloss White w/ Black Rubber

Copper/Green Mirror





91201 Matte Black
Smoke/Blue Mirror









91201 Gloss White
Smoke/Blue Mirror



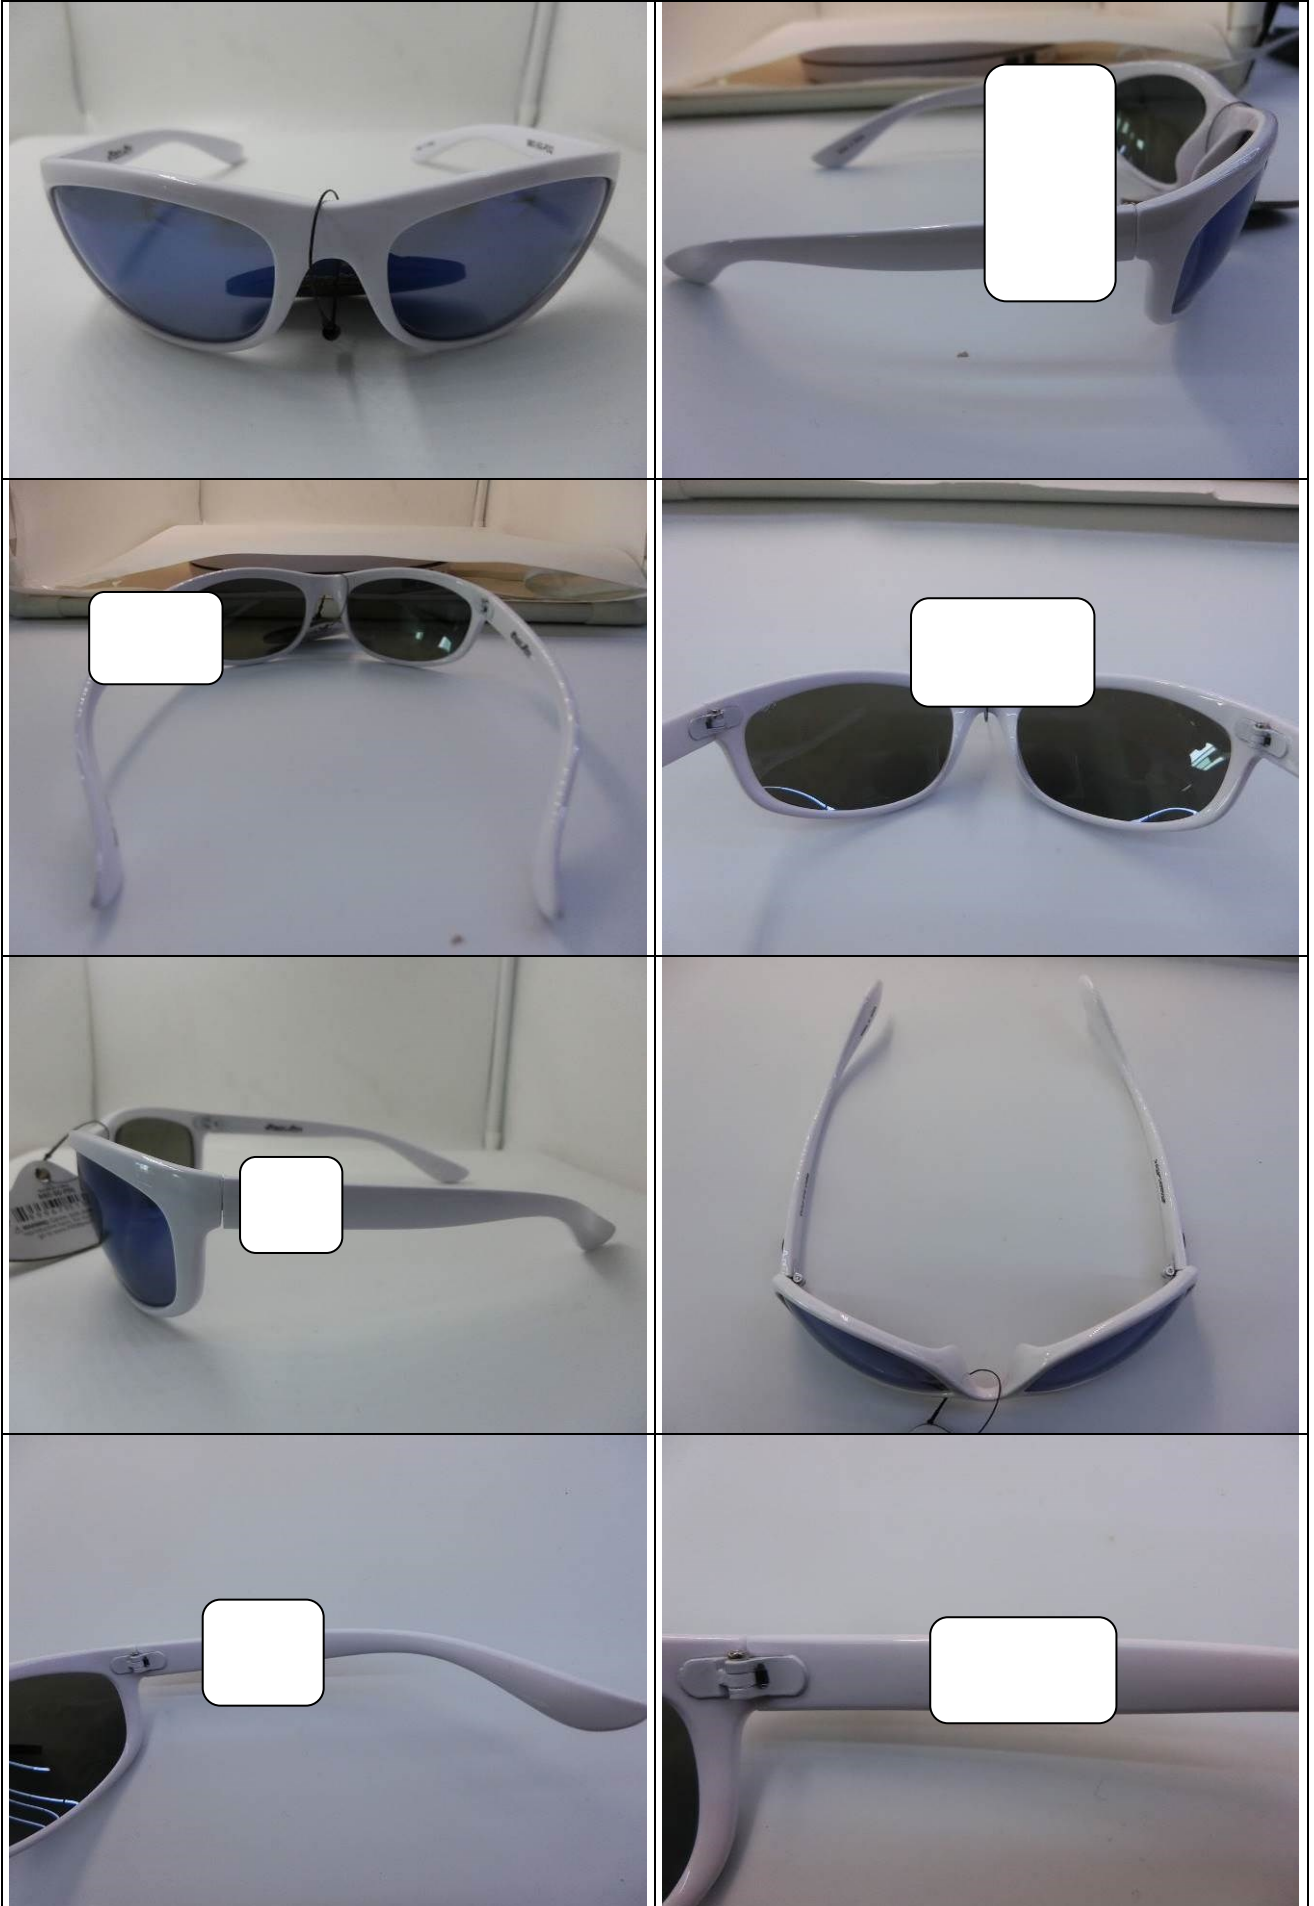


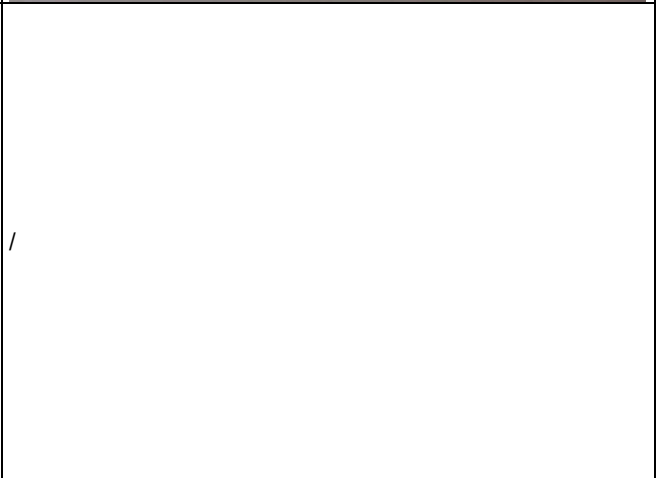

91201 Tortoise
Copper/Green Mirror







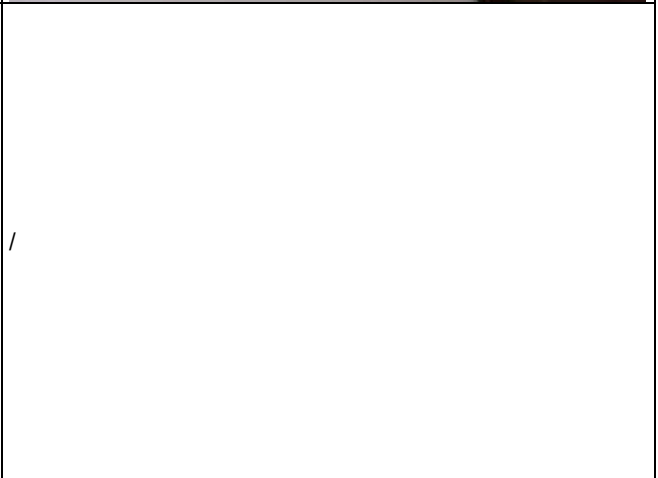

91207 Matte Black
Smoke/Blue Mirror



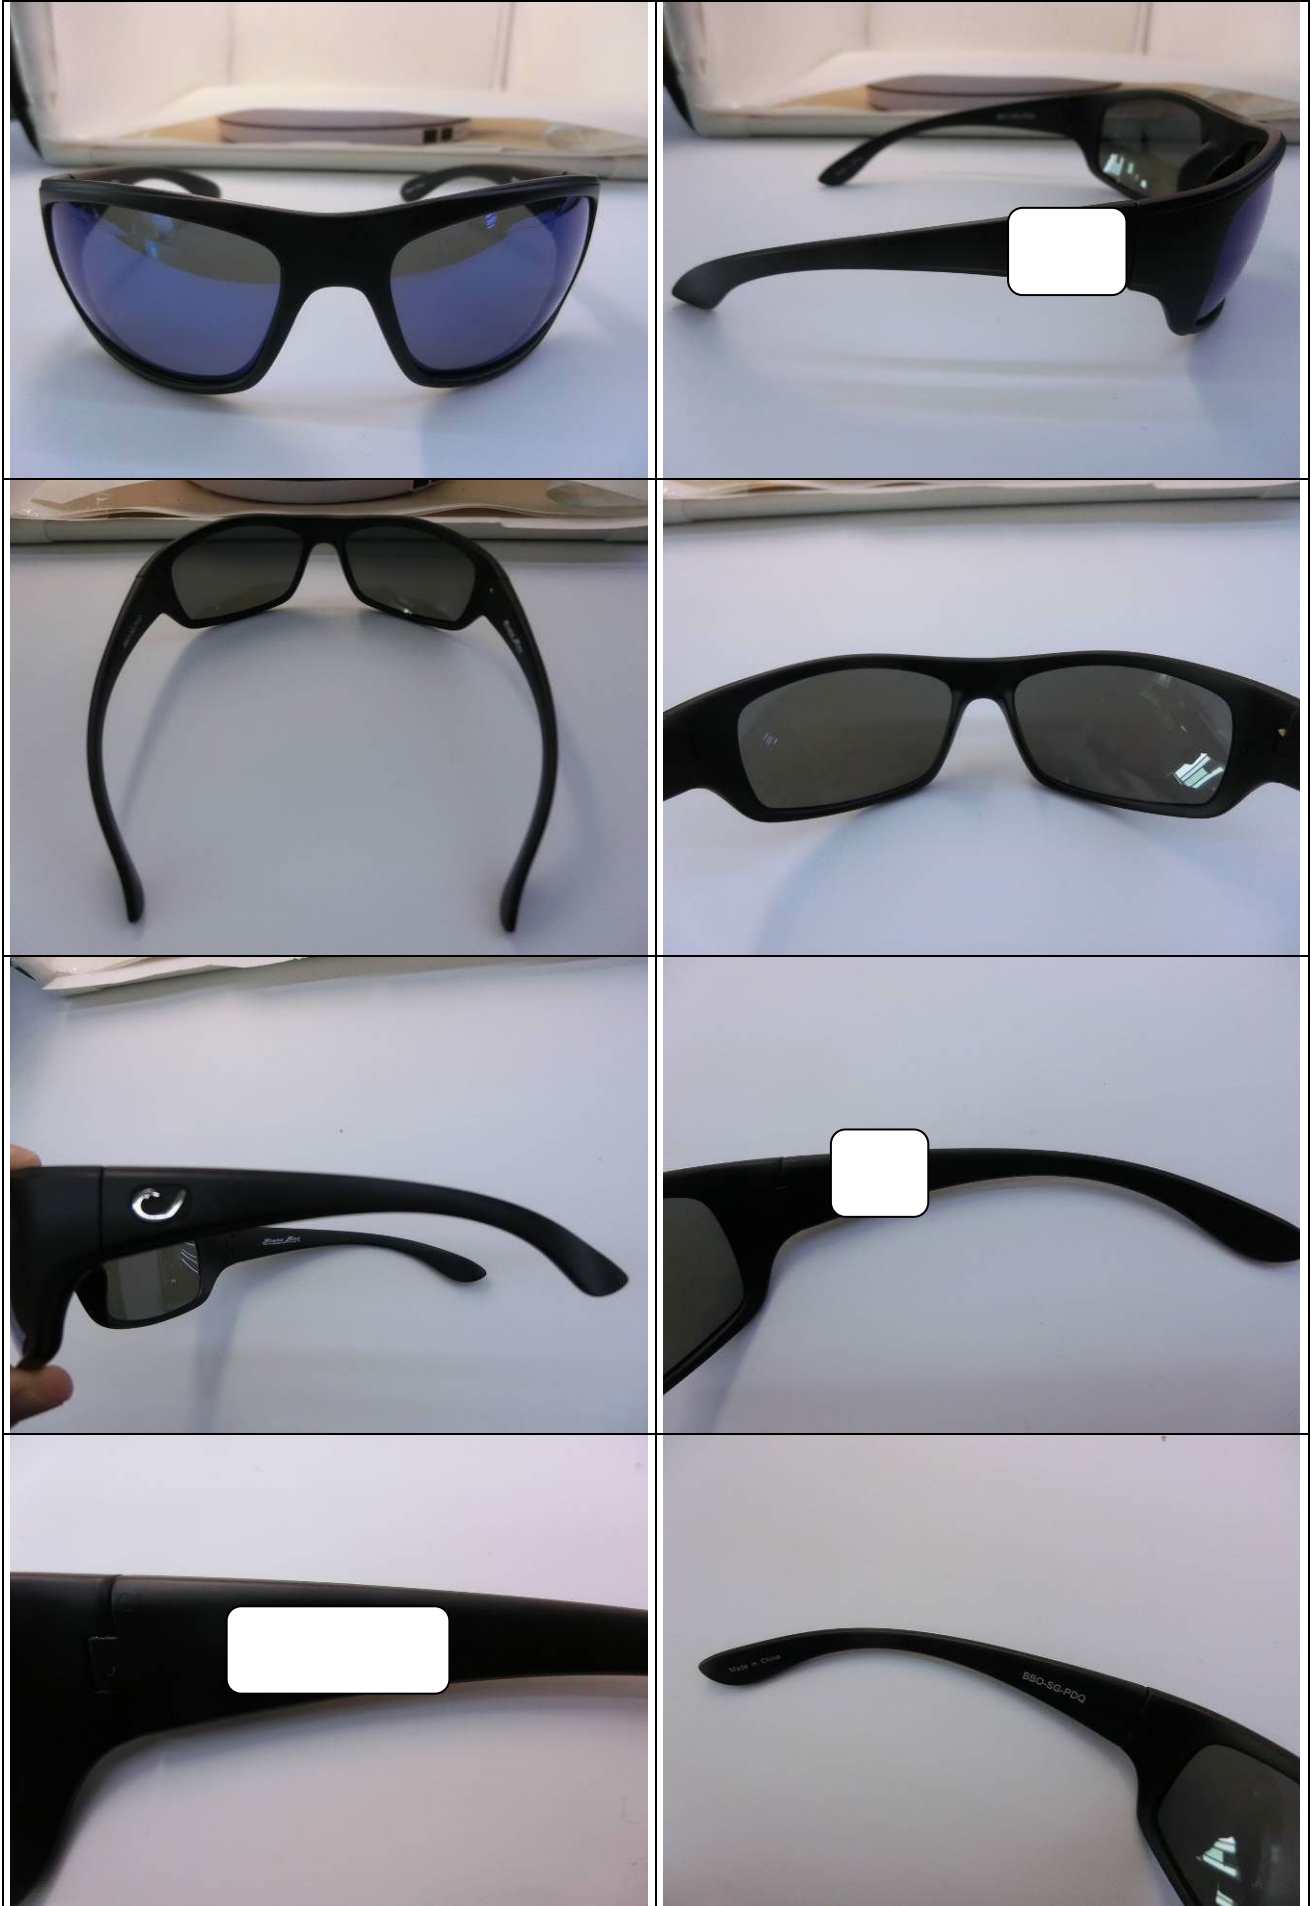


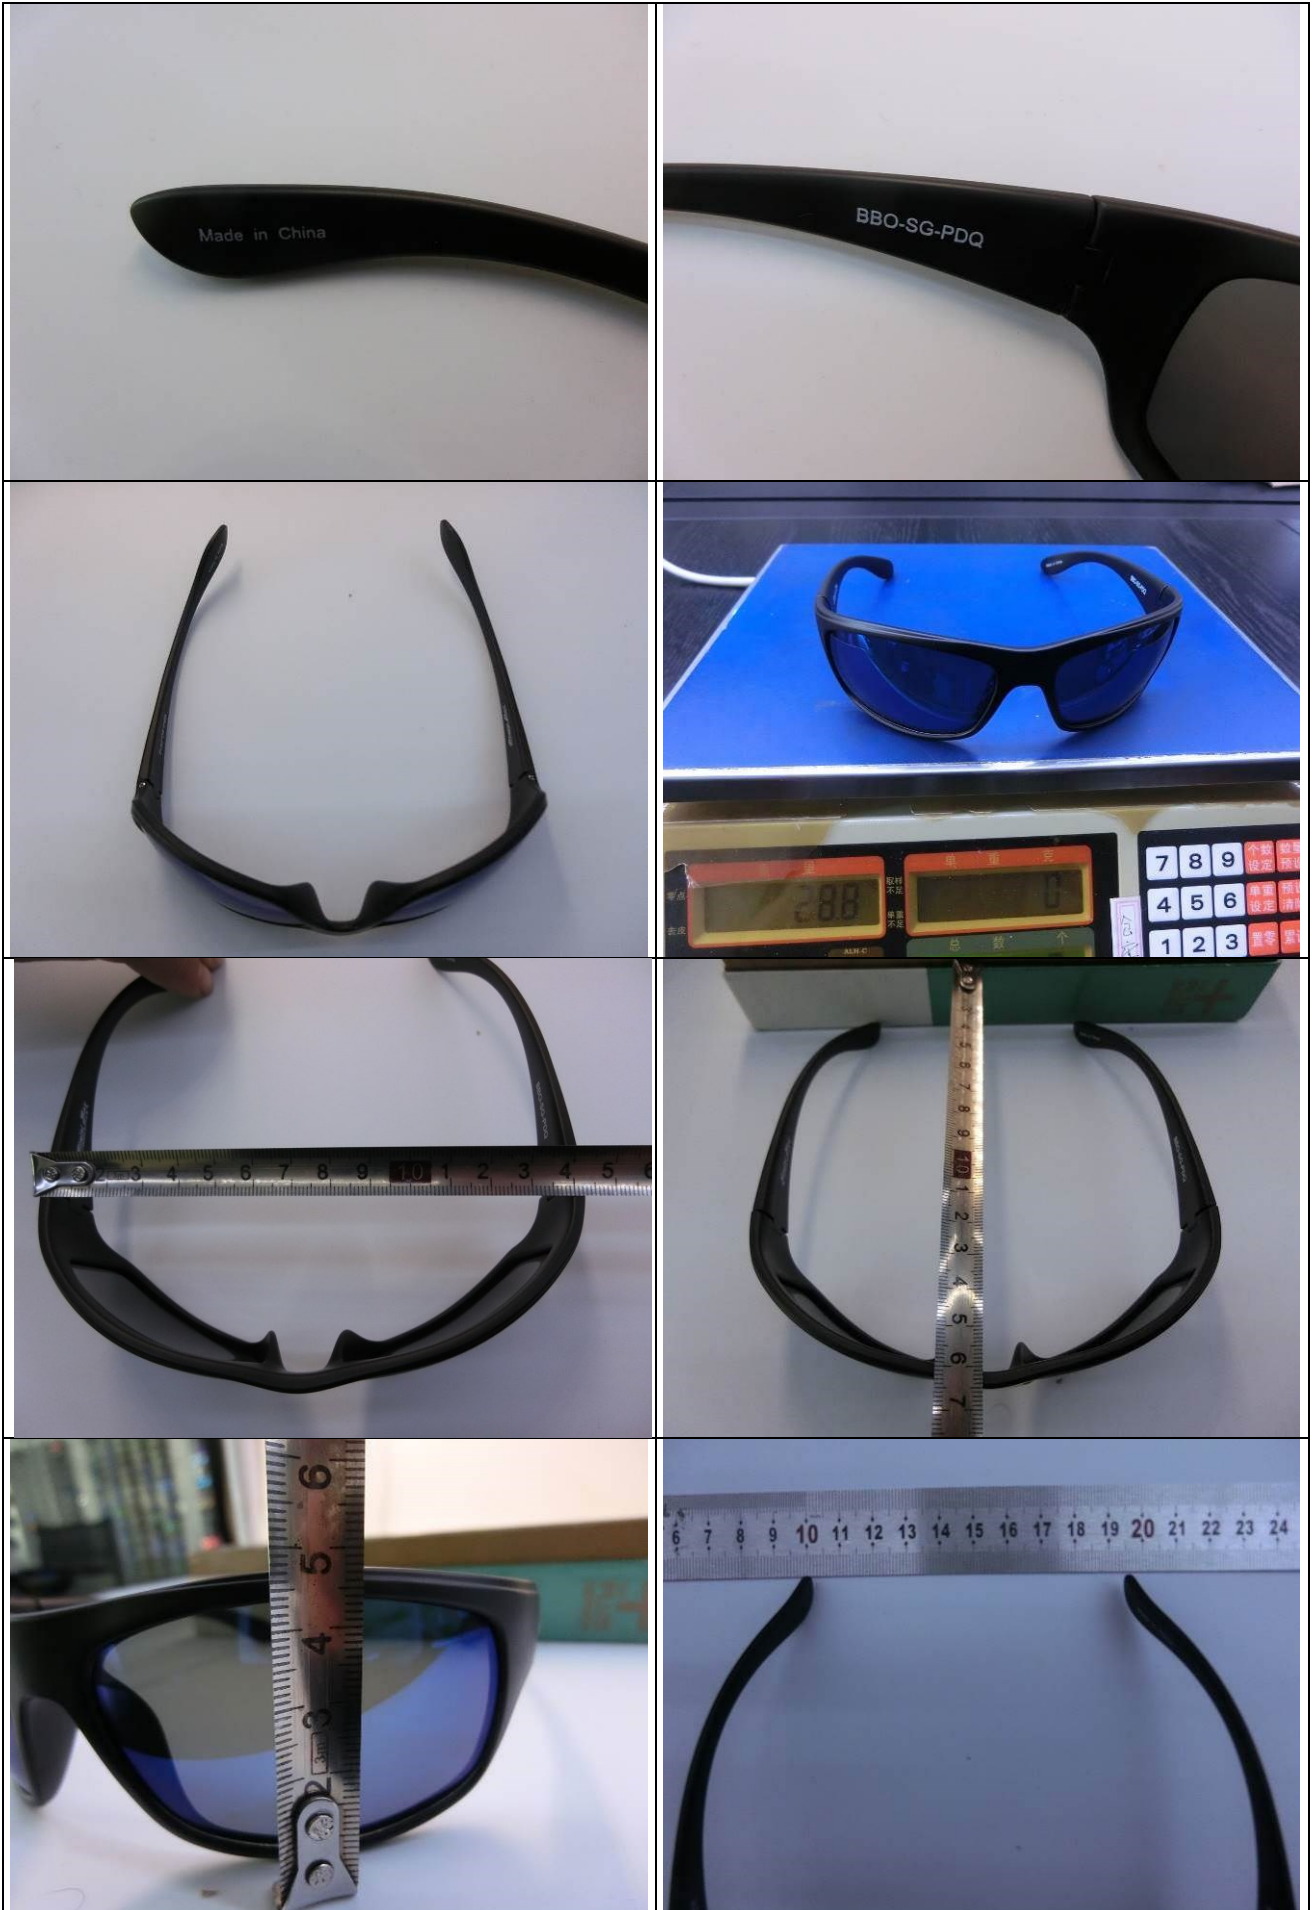

91207 Tortoise

Copper/Green Mirror



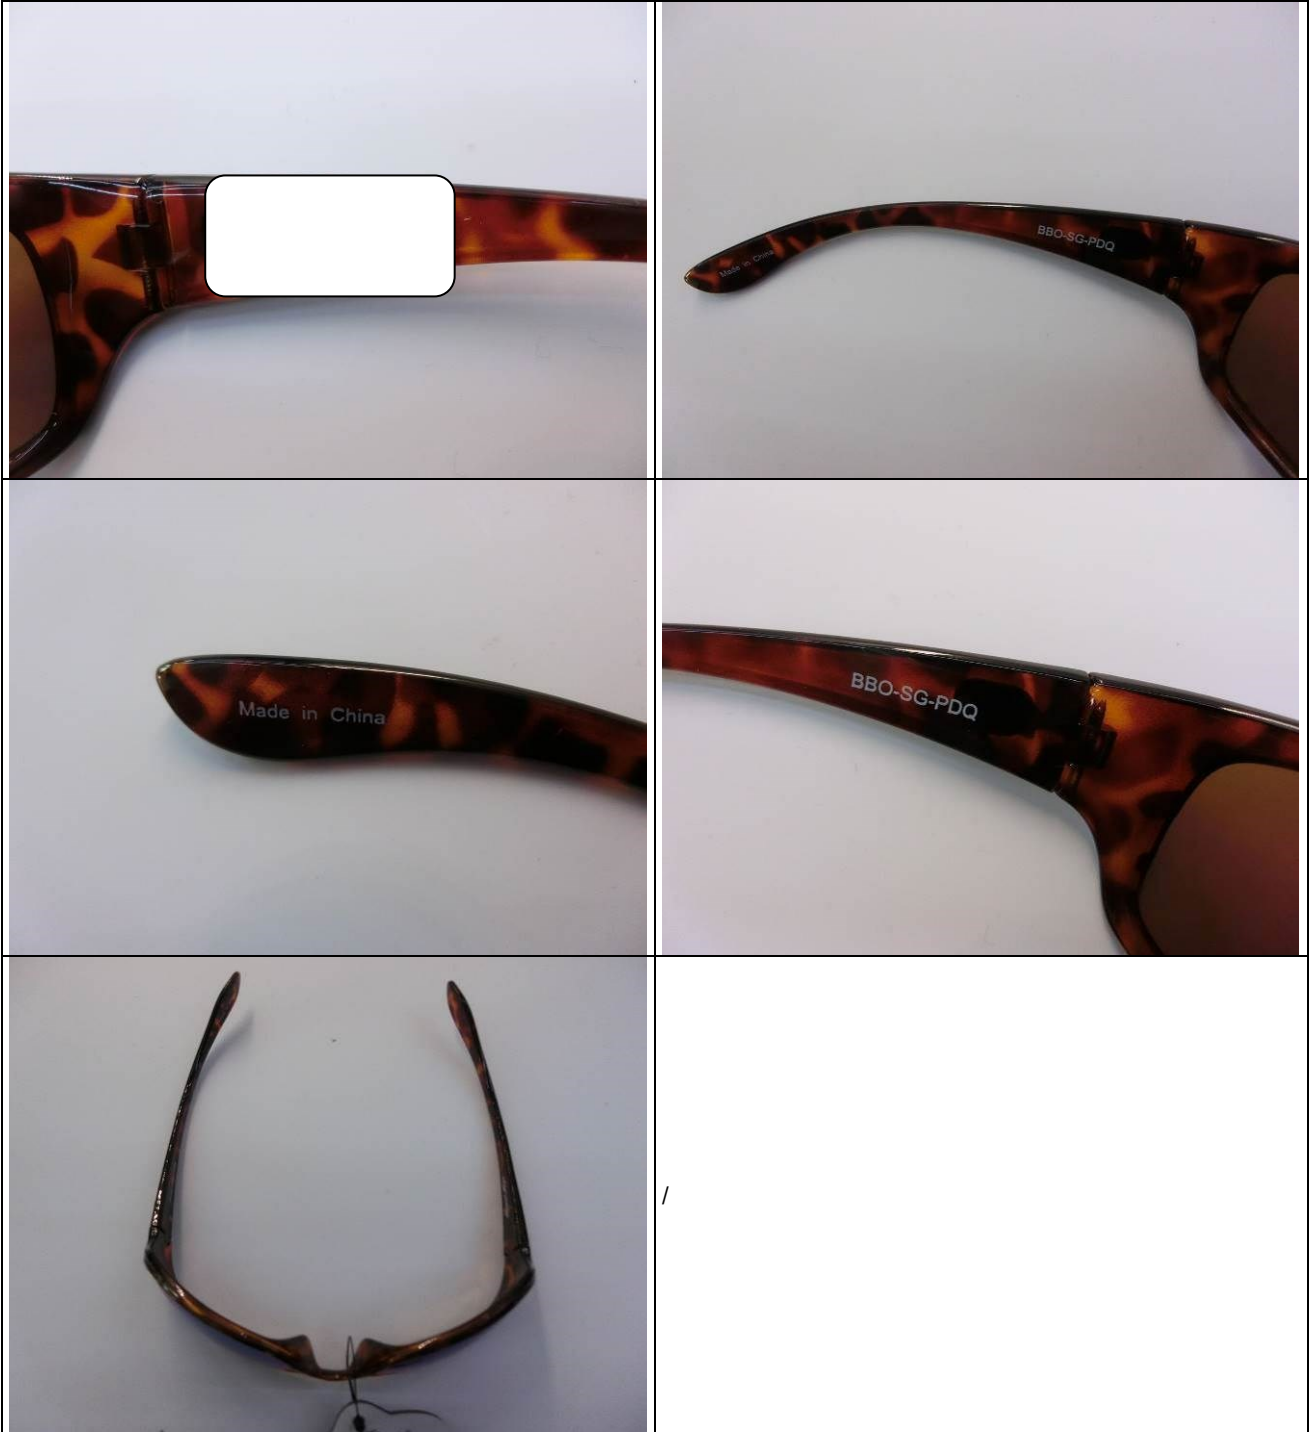

91207 Crystal Grey
Smoke/Blue Mirror





7. Factory General Outlook		
Is the factory/workshop location Same as booked by client?	Factory/Workshop cooperation	Factory/Workshop organization
Yes	Average	Average
Warehouse Cleanliness	Inspection Room Lighting Conditions	Inspection Room Conditions Cleanliness
Average	Bright	Clean
Factory Gate	Production Line	Warehouse



Packing line

Inspection room

Inspected samples

8. Draft Report

AQI
Your Valued Partner

Draft Report
DOCUMENT #: AQI-DOC-Draft REPORT

General Information:

Client name: [REDACTED]

Product name:	Sunglasses	Inspection Date:	2020-4-13
Item #:	BBO-SG-PDQ	PO#	P0520BBOPDQ
Ordered quantity:	12095pcs	Inspection location	Xiamen Fujian
Inspection type	PSI/G-II	AQL Level	Cri. 0 Maj.: 2.5 Min.: 4.0
Sample size inspected	315pcs	Qty. for selected cartons	

2. Workmanship Appearance / Function Inspection

General requirement from client:

#	Description	Cri.	Maj.	Min.	Remarks
14318	Glue mark on frame			1	Reworked
	Foreign mater on frame			1	Replaced
	Dirty mark on lens			2	Reworked
	Scratch mark on lens			1	Replaced
	Particle on frame			1	Reworked
91066	Bubble on frame			1	Replaced
	Scratch mark on frame			1	Replaced
	Bubble on frame			1	Replaced
91201	Dirty mark on frame			1	Reworked
	Color stain on frame			1	Replaced
	Scratch mark on frame			1	Replaced
91207	Dirty mark on lens			1	Reworked
	Particle on frame			1	Reworked
	Glue mark on frame			1	Reworked
91207	Scratch mark on frame			1	Replaced
Total Defects		0	0	16	
Maximum allowed Defects		0	14	21	Within AQL
Sample size		315	315	315	

Conclusion: Pending

AQI Remark:

- Upon the inspection, product 92%/11096pcs finished and 78%/131Ctns packed into cartons.
- The approval sample was not available for reference on site.
- Selected 315pcs samples for inspection, found 0pcs major defects and 16pcs minor defects.

4. Factory refused to do Carton drop test.

5. For 91207 Smoke/Blue Mirror Polarized light test, found result was 9-10 degree beyond +/-3 degree.

6. Customer no provided product size for checking. Pls see actual found.

Manufacturer Signature: [REDACTED]

IMPORTANT NOTES

THE ABOVE RESULT(S) REFLECT(S) AQI QUALITY INSPECTION FINDINGS AT THE TIME AND PLACE OF INSPECTION. THIS REPORT DOES NOT RELEASE THE BUYER OR SELLER FROM CONTRACTUAL RESPONSIBILITIES, NOR DOES IT PREJUDICE THE BUYER'S RIGHT OF CLAIM TOWARD THE SELLER/SUPPLIER FOR COMPENSATION FOR ANY APPARENT AND/OR HIDDEN DEFECTS NOT DETECTED DURING INSPECTION OR OCCURRING ANYTIME THEREAFTER.

End of the Report